

# Technical Bulletin

Model  
911C2/C4/t

Group  
2

Subject: Muffler Mounting

Part Identifier  
2633

Number  
9202

**ATTENTION: Service Manager/Service Technician**

**Models Affected:** 911 Carrera 2/4, all model years  
911 turbo, from model year '91

**Concern:** Final muffler mounting bolt on carrier plate loose or broken.

**Vehicle Information:** A modified spacer sleeve with a larger contact surface area is installed on the **lower bolt** of the final muffler carrier (see Figures 1 and 2). From production date: April 15, 1992

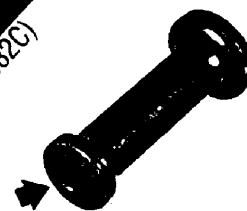
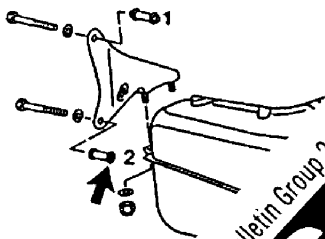


Figure 2

Engine  
62 M  
65  
Manual Transmission  
Electronic  
911 turbo

**Repair Information:**

Use or broken final muffler lower mounting bolts on the above engine numbers, install **lower mounting spacer sleeve**.

**Parts Information:**

Upper spacer sleeve - Part Number 964 111 213 01 (1 in Figure 1)  
Lower spacer sleeve - Part Number 964 111 213 02 (2 in Figure 1)

**SUPERSESSION**  
Bulletin Group 2 No. 9202 dated 3-20-92, replaced by Bulletin Group 2 No. 9304 dated 4-27-93.  
Affix this label across page 43 of Technical Bulletin Book I (PNA 000 082C)

PORSCHE CARS NORTH AMERICA INC.

